



Secure arm firmly to the solid cement wall with two expansion bolts (not supplied).

Secure arm firmly to the solid wood wall with two lag bolts (not supplied).

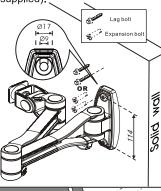

Step 3


Place LCD with facing downward on flat surface. Place VESA on the LCD back as figure and align to the screw holes. Secure them together with four screws .And step 1. 2. 3) then tighten them up with screwdriver(not provided).

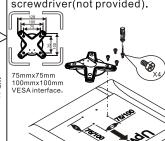

Step 4


Insert the VESA(with LCD display on already)into the arm and press it down.Then secure fixing lump on VESA with knob.(as figure down



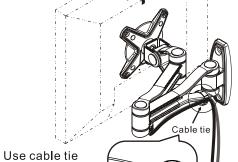


Step 6

When the screw is loosen, please use the AllenKey(5mm)

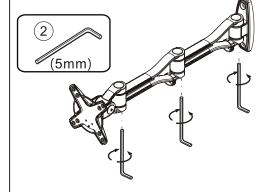

Cautions:

supplied to finish cable management.

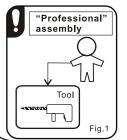








NewStar user's Manual

LCD Monitor Arm FPMA-W1010.FPMA-W1020.FPMA-W1030

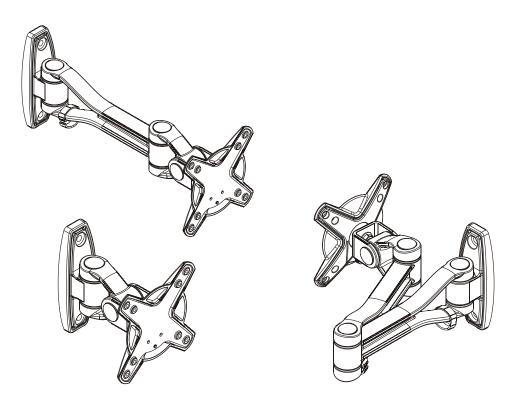




www.NewStar.nl Phone: + 31 (0) 23 547 88 88


Unit: mm

Assembly Guide

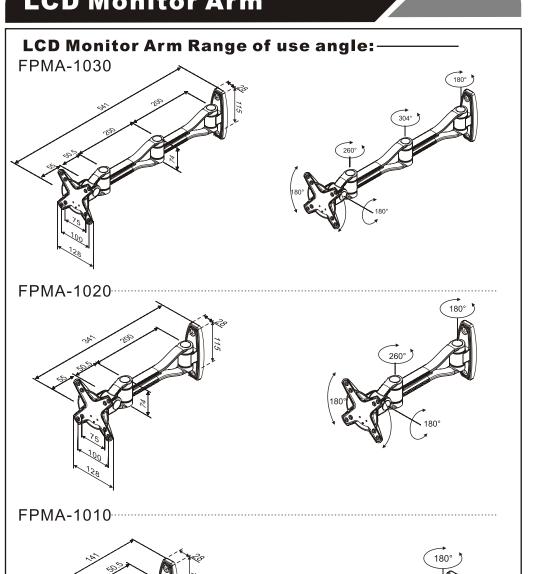


To mount your flat panel monitor or any parts at an ergonomically correct position, start at step 1 and continue as directed.

Part Check-List

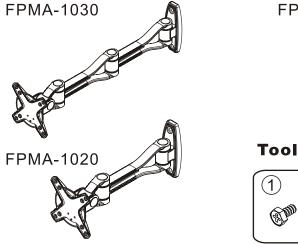

FPMA-1020

Tool Check-List —



Step 1

(1)Please loosen the knob at frist, and then apart the fixing lump.

(2) Then, take VESA up. If it is difficult to take it up, you can take it by knocking slightly(as figure. B)

Please avoid to pinch your hand during assembling the arm.

